

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference	
	Road	High St, Southbound						Assessor				Date	
0	Sign	First Panel Bridge with restricted height 100 yards ahead	1.2mx2.6m	Yes	No	Poor	Metal	110	Map type sign	None	Renew left hand panel. Positively sign the HGV route Dispense with the right hand panel, correct the distance to 150 yards to replicate the sign opposite (See Below)		
	SE Kerbline of Gun Lane	Second Panel Direction to avoid the low bridge	750 (r)	Yes			Metal		None	None	Smaller x height on both		
5.2	Street Name Plate	'High Street'		No	Yes	Poor	Metal	100	New Street Name Plate: 'High Street'	None	Replace with an enamel sign, and attach to the wall.		
6.8	Pedestrian Sign	'Library' Sign on L/C HKA2	550 (w) 250 (h)	Yes	Yes	Adequate	Metal	40	None	None	Remove		
	Loading Plate	'No loading at any time' plate on L/C HKA2	370 (h) 350 (w)	Yes	Yes	Adequate	Metal	20	New Plate reading: No loading Mon – Sat 7.00 – 10.00am Midday – 2.00pm 4.00 – 6.00pm	None	Remove and replace with a new loading plate		

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
6.8	Sign – Not Official	'Drink Aware' Sign on L/C HKA2	450 (h) 350 (w)	Yes	N/A	Good	Metal		None	None	Reduce number of signs through High Street, Strood. Determine the minimum number of signs required.	
8.4	P.O Box			No	Yes	Adequate	Metal	N/A	None	None	Keep	
50.6	Litter Bin	Litter Bin adjacent to Bus Stop	500 x 500	Yes	N/A	Poor	Plastic	N/A	New Litter Bin	None	Replace with new and attach to lamp column north of the bus stop.	

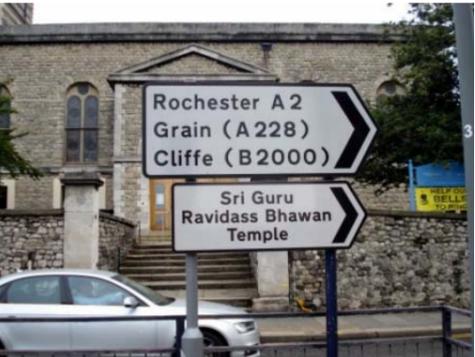
Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/reasons	Picture Reference
69.2	3 Cabinets 2 Feeder Pillars	3/346-N 3/346-347 3/345		Yes		Adequate	Metal	N/A	No	None	Remove	
75	Street Name Plate	'High Street'	230 (h) 1m (w)	Yes	Yes	Poor	Metal	100	New Street Name Plate: 'High Street'	None	Replace with an enamel sign, and attach to the wall.	
79.2	Bollard	Keep Left Bollard (Centre Island)		Yes	Yes	Poor	Plastic	N/A	New Weebol to replace existing	None	Replace existing with a Weebol	
79.4	Guardrail	Around the Centre Island	17m	Yes	Yes	Poor	Metal	N/A	None	None	Remove all guardrail	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/reasons	Picture Reference
80	Traffic Signal	(1) On Island Pedestrian Head Push Button Unit Vehicle Detector Camera										
80	Road Sign	'No entry' On lit post	600 (r)	No	Yes	Good	Metal	N/A	None	None	Keep	
80	Road Sign	'A2' On lit post	400 (w) 380 (h)	No	Yes	Good	Metal		None	None	Remove	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/reasons	Picture Reference
80	Traffic Signal	On North Path Pedestrian Head Push Button Unit										
82.7	Traffic Signal	(2) On Island										

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/reasons	Picture Reference
--------------	------------------	-------------	-----------	----------------------	-----------------	-----------	----------	---------------	--	--------------------------------	-------------------------	-------------------

Road							Assessor				Date	
84.4	Traffic Signal	(3) On Island										
85	Road Sign (top)	Two posted direction sign on Island	970 (h) 2m (w) 550 (r)	Yes	Yes	Good	Metal	80	New Sign with smaller x height	None	Incorporate the 2 signs and replace existing sign with smaller x height.	
	Road Sign (bottom)	Two posted direction sign on Island	430 (h) 1.7 (w)	Yes	Yes	Good	Metal		New Sign without the text: 'Strood Sports Centre'	None		
86	Traffic Signals	(4) On Island Pedestrian Head Push Button Unit										

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
88	Bollard	Plain face Bollard on island		Yes	Yes	Poor	Plastic	N/A	New Weebol to replace existing	None	Replace with new Weebol	
88	Road Sign	Direction Sign on Island (Top)	660 (h) 1.6m (w)	Yes	Yes	Good	Metal	80	New sign to replace existing	None	Smaller x height	
	Road Sign	Direction Sign on Island (bottom)	1.3m (w) 460 (h)	No	Yes	Good	Metal	65	No	None	Keep but incorporate with sign above.	
88	Traffic Signal	(5) On Island Pedestrian Head Push Button Unit										

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/reasons	Picture Reference
89.9	Traffic Signal	(6) On Island										
90.5	Road Sign	'No Entry' Sign on HKA505 - Lit		Yes	Yes	Adequate	Metal	N/A	None	None	Remove	
100.4	Road Sign	One Way sign on HKA7	600 (r)	No	Yes	Adequate	Metal	62	None	None	Keep	
	Road Sign	Ahead Only Sign on HKA7	450 (h)	No	Yes	Adequate	Metal		Additional identical Sign on the other side of carriageway	None	Install identical sign on the other side of carriageway	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
100.4	Loading Plate	No Loading at any time on HKA7	370 350	Yes	Yes	Adequate	Metal	20	New Plate reading: No loading Mon – Sat 7.00 – 10.00am Midday – 2.00pm 4.00 – 6.00pm	None	Remove and replace with a new loading plate	
126.4	Telegraph Pole 30-83 IFCV63			No		Poor	Wood	N/A	None	None	Keep	
148.8	Road Sign	Two posted direction sign on HKA9	1.9 (w) 1.9 (h)	Yes	Yes	Adequate	Metal	100	None	None	Remove	

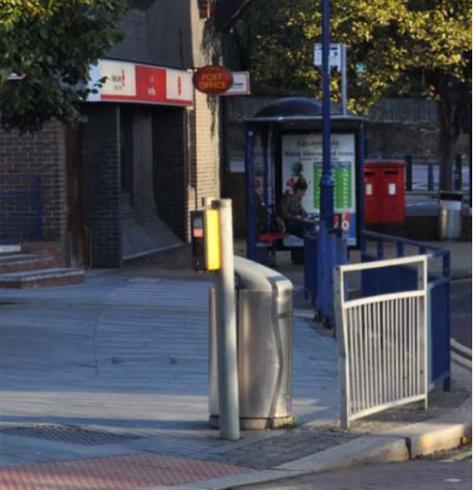
Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/reasons	Picture Reference
148.8	Loading Plate	No Loading at any time on HKA9	370 350	Yes	Yes	Adequate	Metal	20	New Plate reading: No loading Mon – Sat 7.00 – 10.00am Midday – 2.00pm 4.00 – 6.00pm	None	Remove and replace with a new loading plate, to be relocated on L/C HKA9	
148.8	Sign – Not Official	'CCTV in operation' sign	300 (h) 500 (w)	Yes		Poor	Metal	N/A	No	No	Remove	
156.8	CCTV camera	CCTV Camera outside Wilkinsons	400 x 400	Yes		Adequate	Metal	N/A	None	None	Retain	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
156.8	Sign – Not Official	Keep it clean on camera sign	500 (h) 350 (w)	Yes		Good	Metal	N/A	None	None	Reduce number of signs on High Street, Strood	
156.8	Guardrail	On north side of carriageway	24m	Yes	Yes	Poor	Metal	N/A	Deterrent needed to prevent parking	None	Remove all guardrail, but install deterrent to prevent parking outside Wilkinsons	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
	Road						Assessor				Date	
158.7	Black Cabinet	Charles Endirect Ltd	800 x 350	Yes	Yes	Adequate	Metal	N/A	None	None	Remove or Relocate in liaison with traffic signal team	
160.5	Air quality cabinet	Enviro technology services PLC	650 x 1.1m	Yes	Yes	Adequate	Metal	N/A	None	None	Remove or Relocate in liaison with traffic signal team	
174	Direction Sign	Direction sign on L/C HKA 10	1.35 (h) 1.65 (w)	Yes	Yes	Adequate	Metal	80	Additional Sign mounted on L/C HKA 11	None	Sign to be removed. "Rochester 1/2" and "P" to be relocated to L/C HKA 11	
174 on L/C	Sign – Not Official	'Drink Aware' Sign on L/C HKA2	450 (h) 350 (w)	Yes	N/A	Good	Metal	N/A	None	None	Reduce number of signs through High Street, Strood.	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
190.6	Guardrail	Start of	37m	Yes	Yes	Poor	Metal	N/A	None	None	Remove full length	
198.1	Litter Bin	Litter Bin next to L/C HKA 11		No	Yes	Adequate	Metal	N/A	None	None	Keep and locate on lamp column.	
199.2	Direction Sign	One posted Direction Sign on L/C HKA 11	1.5 (w) 780 (h)	Yes	Yes	Adequate	Metal	65	Use the same sign at the junction with North Street	None	Remove sign and install replicate sign on island at North Street	
215.7	CCTV camera	CCTV Camera next to statue	400 x 400	Yes	Yes	Adequate	Metal	N/A	None	None	Reduce number of CCTV Cameras throughout	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
215.7	CCTV in operation	Depth Width	300 500	Yes	Yes	Adequate	Metal	N/A	None	None	Determine if the sign is a legal requirement, if not remove.	
231.4	Traffic Signals	North Street High Street On West Path										

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
0.0 North Street	Stub Post	Stub Post North Street West Side										
0.3	Litter Bin	Litter Bin next to L/C HKA 11		No	Yes	Adequate	Metal	N/A	None	None	Keep and relocate on L/C NDI 1	
0.4	Guardrail	Start of	12m	Yes	Yes	Poor	Metal	N/A	None	None	Remove	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
13.5	Bollard (1)	Removable Bollard		Yes	Yes	Poor	Metal	N/A	None	None	Remove	
15.2	Bollard (2)	Removable Bollard		Yes	Yes	Poor	Metal	N/A	None	None	Remove	
16.9	Bollard (3)	Removable Bollard		Yes	Yes	Poor	Metal	N/A	None	None	Remove	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
18.5	Guardrail	Outside the PO	10m	Yes	Yes	Poor	Metal	N/A	Deterrent needed to prevent parking	None	Remove all guardrail, but install deterrent to prevent parking outside the PO	
38.7	Bell Bollard	Outside the PO		Yes	Yes	Poor	Metal	N/A	Replacement bollard	None	Replace Bollard with new	
OTHER SIDE												OTHER SIDE

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
	Road						Assessor				Date	
36.3	Guardrail	Start of guardrail	42m	Yes	Yes	Poor	Metal	N/A	Deterrent needed	None	Remove all guardrail, replace with deterrent to avoid cars mounting the kerb.	
20	Road Sign	'One way' Sign on Lit post NDI 502	600 (r)	Yes	Yes	Adequate	Metal		Yes. Existing 'one way' sign to be relocated to L/C NDI 4	None	Put on L/C NDI 4	
20	Loading Plate	No Loading at any time	370 350	Yes	Yes	Adequate	Metal	20	New Plate reading: No loading Mon – Sat 7.00 – 10.00am Midday – 2.00pm 4.00 – 6.00pm	None	Remove and replace with a new loading plate	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
20	S.N.P	'North Street'	1.23m (w) 155 (h)	No	Yes	Adequate	Metal	100	None	None	Keep	
12.4	CCTV in operation	Depth Width	300 500	Yes	Yes	Adequate	Metal	N/A	None	None	Remove through liaison with Community Safety division	
12.4	Sign – Not Official	'Drink Aware' Sign on L/C NDI 4	450 (h) 350 (w)	Yes	N/A	Good	Metal	N/A	None	None	Remove through liaison with Community Safety division	
12	Litter Bin			No	Yes	Adequate	Metal	N/A	None	None	Keep and relocate on L/C NDI 4	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/reasons	Picture Reference
0	Control Box	Siemens 3-320 3-320N		Yes	Yes	Adequate	Metal	N/A	None	None	Remove or relocate through liaison with Traffic Signals team	
-3	Traffic Signals on path											
End of North Street												
240.1	Stub Post											

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/reasons	Picture Reference
240.1	Illuminated Bollard			Yes	Yes	Poor	Plastic	N/A	Replace existing with a new Weebol	None	Replace existing with a Weebol	
240.1	Direction Sign (Top)	Direction Sign: "Grain 12 (A228) Cliffe 4 3/4 (B2000)"	1m (h) 1.6m (w)	Yes	Yes	Adequate	Metal	100	None	None	Remove	
	Direction Sign (Bottom)	Upnor Castle	1.3 (h) 330 (w)					65			Remove	
240.1	Illuminated Bollard	Keep left Bollard towards North Street		Yes	Yes	Poor	Plastic	N/A	Replace existing with new Weebol	None	Replace existing with Weebol	
240.1	Stub Post											

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
240.1	Traffic signal on island (1)										Green aspect on Traffic signal	
240.1	Traffic signal on island (SW side)											
242	Stub Post SW											

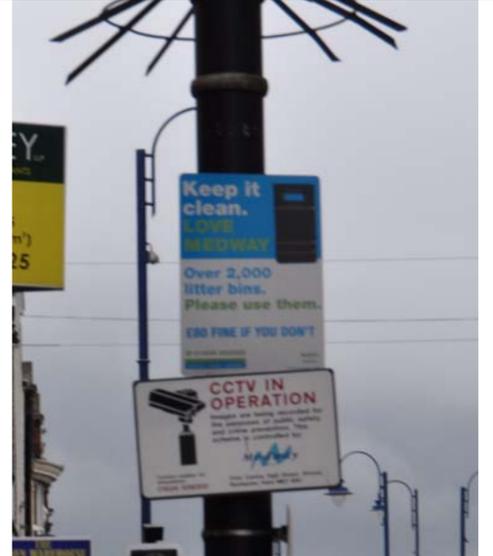
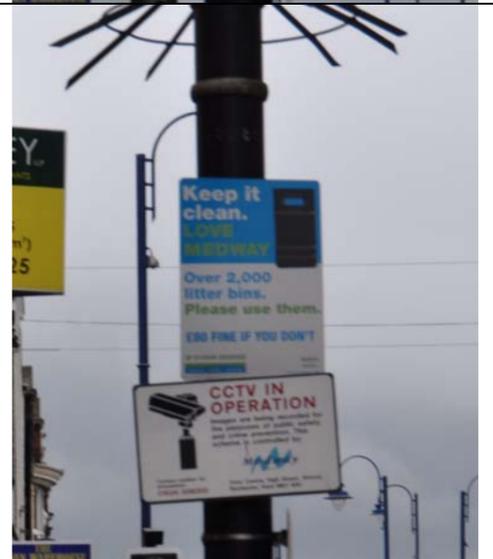
Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/reasons	Picture Reference
--------------	------------------	-------------	-----------	----------------------	-----------------	-----------	----------	---------------	--	--------------------------------	-------------------------	-------------------

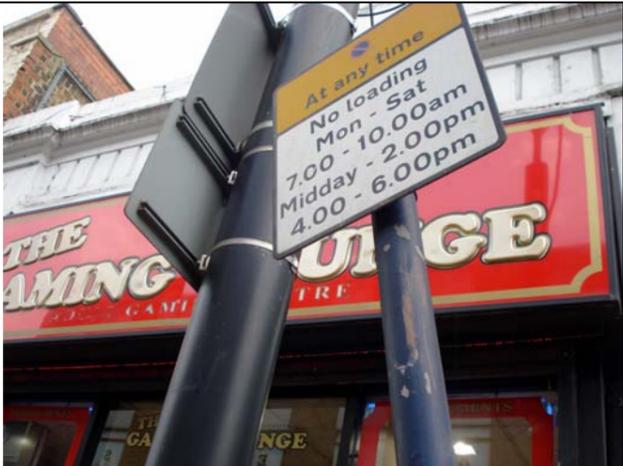
Road							Assessor				Date	
242	Stub Post N											
246.2	Traffic Signal (3)											
246.8	Traffic Signal (4)											

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
246.2	Stub Post x 2											
0	Guardrail	Start of Guardrail	36m	Yes	Yes	Adequate	Metal	N/A	Deterrent needed	None	Remove all guardrails and replace with deterrent to disable cars from mounting the kerb.	
0.8	Stub Post											
2	Litter Bin			No	Yes	Adequate	Metal	N/A	None	None	Relocate on nearby lamp column HKA 50	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
22.4	Litter Bin			No	Yes	Adequate	Metal	N/A	None	None	Relocate on nearby lamp column HKA 17	
28.3	Loading Plate	No Loading at any time	370 350	Yes	Yes	Adequate	Metal	20	New Plate reading: No loading Mon – Sat 7.00 – 10.00am Midday – 2.00pm 4.00 – 6.00pm	None	Remove and replace with a new loading plate	
28.3	Pedestrian Sign	“Toilet” sign	250 (h)	No	Yes	Adequate	Metal		None	None	None	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
48.5	Road Sign	Two posted junction sign		Yes	Yes	Adequate	Metal		New sign to replace existing.	None	Remove 'Chatham A2' 'Grain (A228)' 'West Malling (A228)' Add Bridge restriction "London" to be in green and yellow	
50.3	Ahead only on HKA 18			No	Yes	Adequate	Metal	N/A	Lit	None	None	
50.3	Loading Plate	No Loading at any time	370 350	Yes	Yes	Adequate	Metal	20	New Plate reading: No loading Mon – Sat 7.00 – 10.00am Midday – 2.00pm 4.00 – 6.00pm	None	Remove and replace with a new loading plate	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
75.3	CCTV post			Yes	Yes	Adequate	Metal	N/A	None	None	Reduce number of CCTV Cameras in Strood High Street in liaison with Community Safety service.	
75.3	Love Medway Sign on CCTV post										Remove	
75.3	CCTV sign	CCTV in operation	300 (h) 500 (w)	Yes	Yes	Adequate	Metal	N/A	None	None	Reduce number of CCTV Cameras in Strood High Street in liaison with Community Safety service.	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
76.3	Loading Plate	No Loading at any time	370 350	Yes	Yes	Adequate	Metal	20	New Plate reading: No loading Mon – Sat 7.00 – 10.00am Midday – 2.00pm 4.00 – 6.00pm	None	Remove and replace with a new loading plate	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/reasons	Picture Reference
--------------	------------------	-------------	-----------	----------------------	-----------------	-----------	----------	---------------	--	--------------------------------	-------------------------	-------------------

Road							Assessor				Date	
95.9	Traffic Signal										Convert to Puffin crossing	
100.5	Guardrail	Start of Guardrail	36.5m	Yes	Yes	Poor	Metal	N/A	Remove guardrail	None	Remove Guardrail until chainage 137.00	
107.3	Police sign	On HKA 20		Yes	No	Poor	Plastic	N/A	None	None	Remove	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/reasons	Picture Reference
111.6	Warning Sign	Lit Height warning sign on HKA 507		Yes	Yes	Adequate	Metal		None	None	Remove	
137	Proposed end of guardrail											
End of southbound route												

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
--------------	------------------	-------------	-----------	----------------------	-----------------	-----------	----------	---------------	--	--------------------------------	--------------------------	-------------------

Road	High Street - Northbound						Assessor				Date	
0 Ferndale Corner	Direction Sign	'London A2' 'West Malling (A228)' 'M2' 'Cuxton 2 ½ ' 'Halling 4 ¼ ' 'P' 'Civic Centre'		Yes	Yes	Adequate	Metal		New sign to replace existing two	None	Remove: 'West Malling' 'Cuxton 2 ½ ' 'Halling 4 ¼ ' 'Civic Centre' 1 post only	
4.5	Traffic signal with vehicle detector											
16.1	Traffic signal											
90	Loading Plate	No Loading at any time	370 350	Yes	Yes	Adequate	Metal	20	New Plate reading: No loading Mon – Sat 7.00 – 10.00am Midday – 2.00pm 4.00 – 6.00pm	None	Remove and replace with a new loading plate	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/reasons	Picture Reference
104.3	Police Bay and Pole	'No stopping except Police'		No	Yes	Adequate	Metal	N/A	None	None	Renew marking	
105.5	Guardrail	Start of Guardrail	6m	Yes	Yes	Poor	Metal	N/A	None	None	Remove length of guardrail	
109	Litter Bin			No	Yes	Adequate	Metal	N/A	None	None	Relocate on nearby post to the south	
110.3	Stub Post											

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
114.7	Traffic signal											
115.3	Guardrail	Start of guardrail	26m	Yes	Yes	Poor	Metal	N/A	Footpath to be widened.	None	Remove all guardrails. Widen footpath opposite the Butchers to allow enough room for pedestrians to pass safely.	
118.2	CCTV camera	CCTV Camera near Butchers	400 x 400	Yes	Yes	Adequate	Metal	N/A	None	None	Reduce number of CCTV Cameras throughout	
118.2	Keep Medway Clean Sign	On CCTV Post		Yes	No	Adequate	Metal	N/A	None	None	Remove in liaison with the Community Safety team.	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
131.7	Guardrail	End of Guardrail	As Before	As Before	As Before	As Before	As Before	As Before	As Before	As Before	As Before	
138.9	Road Sign	No through route (816.1)		Yes	Yes	Adequate	Metal	N/A	New Street Name Plate and No Through route Sign	None	Remove existing sign and replace with a new street name plate with a no through route sign attached.	
140.9	Guardrail	Start of guardrail	32m	Yes	Yes	Poor	Metal	N/A	None	None	Remove Guardrail	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
145.4	Loading Plate	'No loading at any time' plate on post	370 (h) 350 (w)	Yes	Yes	Adequate	Metal	20	New Plate reading: No loading Mon – Sat 7.00 – 10.00am Midday – 2.00pm 4.00 – 6.00pm	None	Remove and replace with a new loading plate	
173	Guardrail	End of Guardrail	32m	As before	As before	As before	As before	As before	As before	As before	As before	
174.8	Guardrail	Start of guardrail	28m	Yes	Yes	Poor	Metal	N/A	None	None	Remove all Guardrail	
195.7	Loading Plate	'No loading at any time' plate on post	370 (h) 350 (w)	Yes	Yes	Adequate	Metal	20	New Plate reading: No loading Mon – Sat 7.00 – 10.00am Midday – 2.00pm 4.00 – 6.00pm	None	Remove and replace with a new loading plate	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
203.5	Guardrail	End of guardrail	28m	As before	As before	As before	As before	As before	As before	As before	As before	
220.8	Litter Bin			No	Yes	Adequate	Metal	N/A	None	None	Keep and relocate on /C HKA 8	
225.8	Loading Plate	'No loading at any time' plate on HKA 8	370 (h) 350 (w)	Yes	Yes	Adequate	Metal	20	New Plate reading: No loading Mon – Sat 7.00 – 10.00am Midday – 2.00pm 4.00 – 6.00pm	None	Remove and replace with a new loading plate	
235.2	Guardrail	Start of guardrail	20m	Yes	Yes	Poor	Metal	N/A	None	None	Remove all guardrail	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/reasons	Picture Reference
255.5	Guardrail	End of guardrail	20m	As before	As before	As before	As before	As before	As before	As before	As before	
260	Guardrail	Start of guardrail	2m	Yes	Yes	Poor	Metal	N/A	None	None	Remove all guardrail	
275.6	Traffic signal											

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/reasons	Picture Reference
286.2	Road Sign	Two direction warning sign on HKA 5		No	Yes	Adequate	Metal	N/A	None	None	Keep and light as principal route	
286.2	Loading Plate	'No loading at any time' plate on L/C HKA5	370 (h) 350 (w)	Yes	Yes	Adequate	Metal	20	New Plate reading: No loading Mon – Sat 7.00 – 10.00am Midday – 2.00pm 4.00 – 6.00pm	None	Remove and replace with a new loading plate	
286.2	Road Sign	No Entry on HKA 5		No	Yes	Adequate	Metal	N/A	None	None	Keep	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
317.9	Guardrail	All Guardrail from 317.9 to the extent of Strood High Street		Yes	Yes	Poor	Metal	N/A	None	None	Remove all guardrail	
317.9	Loading Plate	'No loading at any time' plate on L/C HKA 3	370 (h) 350 (w)	Yes	Yes	Adequate	Metal	20	New Plate reading: No loading Mon – Sat 7.00 – 10.00am Midday – 2.00pm 4.00 – 6.00pm	None	Remove and replace with a new loading plate	
358.3	Traffic signal											
363	Loading Plate	'No loading at any time' plate on L/C HKA1	370 (h) 350 (w)	Yes	Yes	Adequate	Metal	20	New Plate reading: No loading Mon – Sat 7.00 – 10.00am Midday – 2.00pm 4.00 – 6.00pm	None	Remove and replace with a new loading plate	
End of Route												

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/ reasons	Picture Reference
--------------	------------------	-------------	-----------	----------------------	-----------------	-----------	----------	---------------	--	--------------------------------	--------------------------	-------------------

Road	Cuxton Road - Westbound											Date
0	Traffic Island	Guardrail	24m	Yes	Yes	Adequate	Metal	N/A	None	None	Remove all guardrail	
0	Loading Plate	No Loading at any time	370 350	Yes	Yes	Adequate	Metal	20	New Plate reading: No loading Mon – Sat 7.00 – 10.00am Midday – 2.00pm 4.00 – 6.00pm	None	Remove and replace with a new loading plate	
0	Sign	Regulatory No Entry	600	No	Yes	Adequate	Metal		None	Head on collisions	Retain	
0	Street furniture	Signal cabinets									Relocate	
0	Sign	Regulatory No Entry	600	No	Yes	Adequate	Metal		None	Head on collisions	Retain	

Chainage (m)	Street Furniture	Description	Size (mm)	Reduction Applicable	Legally Correct	Condition	Material	X Height (mm)	Additional restriction/furniture required?	Safety implications if removed	Recommendations/reasons	Picture Reference
0	Sign	Warning Two-way traffic on route crossing ahead	600	No	Yes	Adequate	Metal		None	Side impact crashes	Retain	
12	Sign	Directional Over height Vehicles London A2 Graves'nd A226	1800 x 700	Yes		Adequate	Metal			Bridge Strikes	Retain but reduce X height Signing for over height vehicle route required via North Street	
12	Sign	Tourist Directional Historic Rochester	1600 x 300	Yes		Adequate	Metal		None	None	Retain but reduce X height	
End of Route												